



TRANSFORMER BOBBIN  
INDUSTRIAL CO.,LTD.







Phone 886-2-22925999

Fax 886-2-22925235

E-MAIL: tbi6666@ms48.hinet.net

# REVISIONS

| REV | SYM | DRAFTER | CHECKER | DATE     |
|-----|-----|---------|---------|----------|
| △   |     | T.S.LI  | W.H.HSU | 02/05/01 |
| △   |     | T.S.LI  | W.H.HSU | 05/03/01 |
| △   |     |         |         |          |

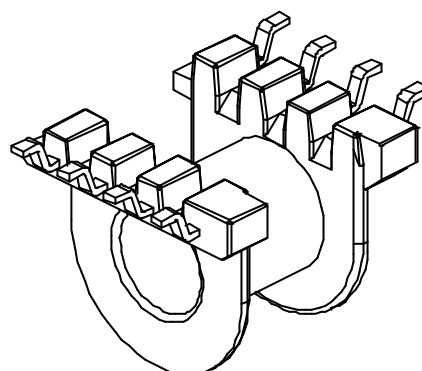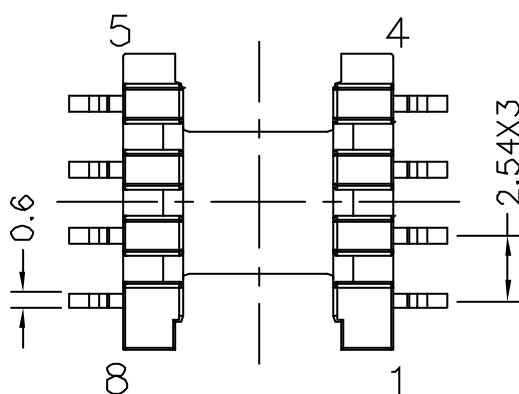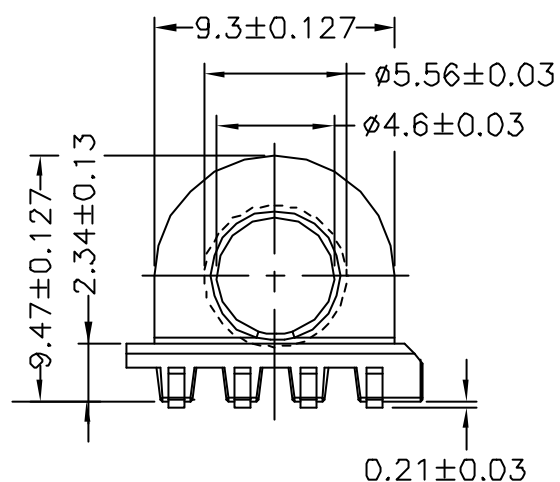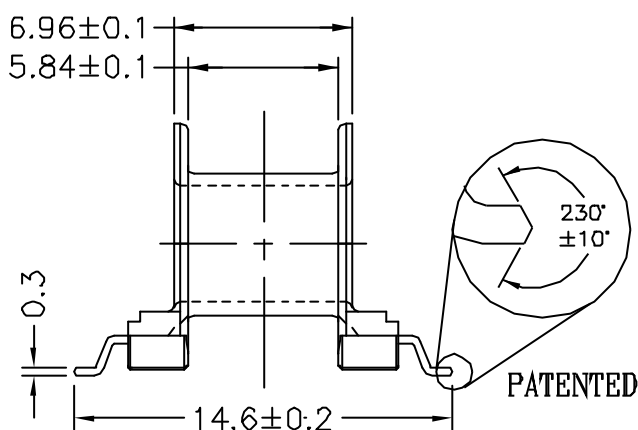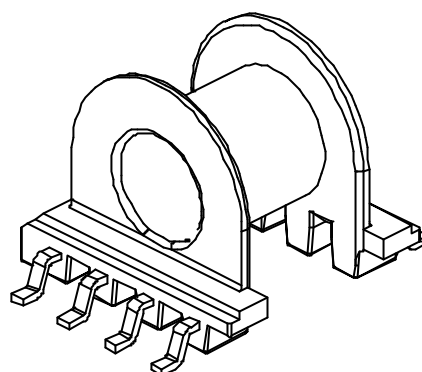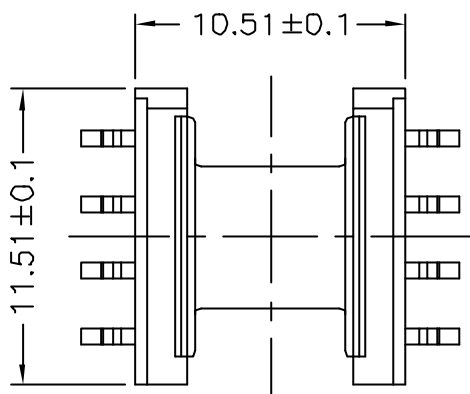

PART NO. EP10-8P-GW-2.54-B-2

DWG NO. TBI-103-02021.2XX

| TBI NO. | MATERIAL (BOBBIN) | MATERIAL (TERMINAL) | TERMINAL (PLATING) |
|---------|-------------------|---------------------|--------------------|
|---------|-------------------|---------------------|--------------------|

|               |        |           |    |
|---------------|--------|-----------|----|
| 103-02021.2XX | AM-113 | P-B C5181 | Au |
|---------------|--------|-----------|----|

Finish:

1. Immersion gold on terminal.  
Thickness gold 0.075  $\mu$ m (3  $\mu$  inches) min.  
Base nickel 0.025  $\mu$ m (25  $\mu$  inches) min.  
2. Coplanarity deviation: 0.004 inches max.

201

ALL PIN

PART NO.

REV

MODE NO

PIN LOCATION

TOLERANCE

X X X

UNIT

mm

SCALE

3.5:1

REV

2